

*TMS320 DSP
DESIGNER'S NOTEBOOK*

TMS320C5x Interrupt Response Time

APPLICATION BRIEF: SPRA220

*Jeff Beinart
Digital Signal Processing Products
Semiconductor Group*

*Texas Instruments
March 1993*



IMPORTANT NOTICE

Texas Instruments (TI) reserves the right to make changes to its products or to discontinue any semiconductor product or service without notice, and advises its customers to obtain the latest version of relevant information to verify, before placing orders, that the information being relied on is current.

TI warrants performance of its semiconductor products and related software to the specifications applicable at the time of sale in accordance with TI's standard warranty. Testing and other quality control techniques are utilized to the extent TI deems necessary to support this warranty. Specific testing of all parameters of each device is not necessarily performed, except those mandated by government requirements.

Certain application using semiconductor products may involve potential risks of death, personal injury, or severe property or environmental damage ("Critical Applications").

TI SEMICONDUCTOR PRODUCTS ARE NOT DESIGNED, INTENDED, AUTHORIZED, OR WARRANTED TO BE SUITABLE FOR USE IN LIFE-SUPPORT APPLICATIONS, DEVICES OR SYSTEMS OR OTHER CRITICAL APPLICATIONS.

Inclusion of TI products in such applications is understood to be fully at the risk of the customer. Use of TI products in such applications requires the written approval of an appropriate TI officer. Questions concerning potential risk applications should be directed to TI through a local SC sales office.

In order to minimize risks associated with the customer's applications, adequate design and operating safeguards should be provided by the customer to minimize inherent or procedural hazards.

TI assumes no liability for applications assistance, customer product design, software performance, or infringement of patents or services described herein. Nor does TI warrant or represent that any license, either express or implied, is granted under any patent right, copyright, mask work right, or other intellectual property right of TI covering or relating to any combination, machine, or process in which such semiconductor products or services might be or are used.

TRADEMARKS

TI is a trademark of Texas Instruments Incorporated.

Other brands and names are the property of their respective owners.

CONTACT INFORMATION

US TMS320 HOTLINE	(281) 274-2320
US TMS320 FAX	(281) 274-2324
US TMS320 BBS	(281) 274-2323
US TMS320 email	dsph@ti.com

Contents

Abstract.....	7
Design Problem	8
Solution	8

Figures

Figure 1. Example of a Bar Code with Interrupts Generated At Edges.....	9
--	----------

Tables

Table 1. Calculating the minimum time between interrupts	11
---	-----------

TMS320C5x Interrupt Response Time

Abstract

This document discusses the important issues in TMS320C5x interrupt latency/processing. In it, the speed at which the TMS320C5x can recognize consecutive interrupts is calculated. This time depends on the interrupt latency and the time required to service the interrupt. A practical application, a bar code scanner routine, will be used as an example.



Design Problem

What are the important issues in TMS320C5x interrupt latency/processing?

Solution


This design note calculates the speed at which the TMS320C5x can recognize consecutive interrupts. This time depends on the interrupt latency and the time required to service the interrupt. A practical application, a bar code scanner routine, will be used as an example.

Figure 1 shows a bar code where the bar widths and the spacing between bars are different, signifying a specific number associated with each bar. To determine the width of a scanned bar, external hardware must generate an interrupt at both the leading and trailing edges of the bar. The TMS320C5x context switches to an ISR, which copies the contents of a Timer Register out to data memory. At some later time we can subtract the timer values, corresponding to each interrupt, and multiply by the Timer clock period to find the bar width.

The Timer clock frequency is a key parameter. A higher frequency yields a more accurate calculation.

Bar Code Width = (Difference in Timer Values)*(CLKOUT1 period)

Figure 1. Example of a Bar Code with Interrupts Generated At Edges

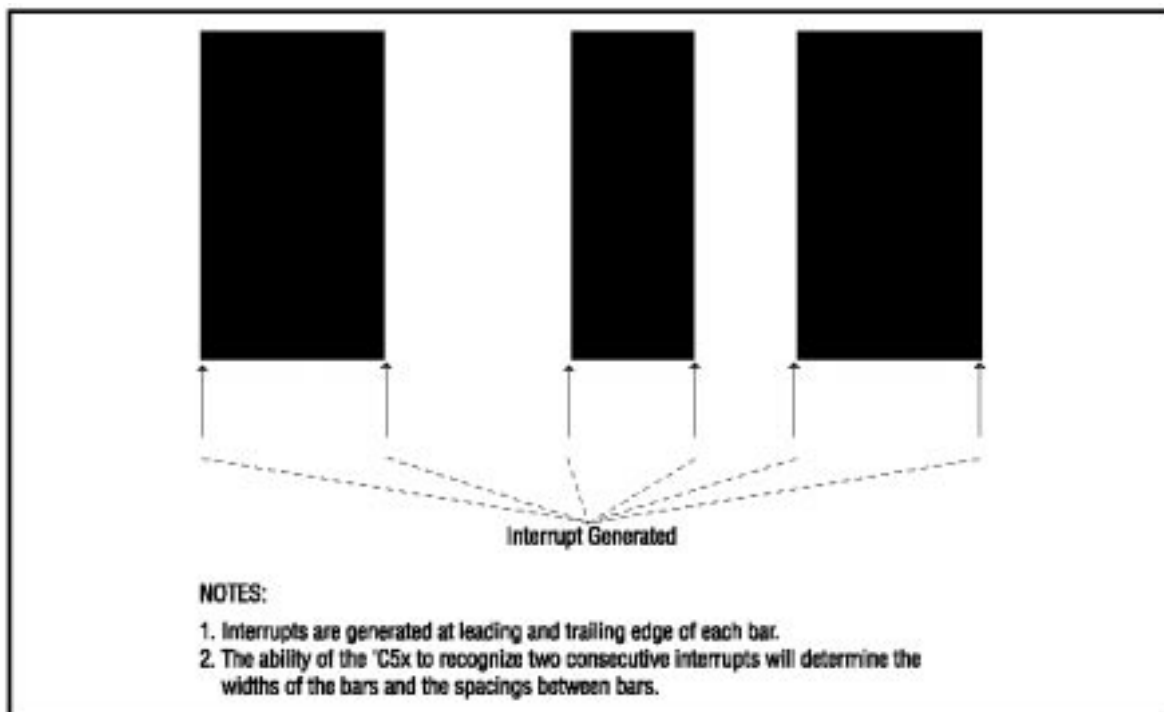

Problem Definition

- 1) Use a TMS320C5x80 running at an internal machine rate of 40 MHz (internal machine period of 25 ns per cycle).
- 2) There are two stages to the Timer with each stage consisting of a period register and a counter register. Only the 16-bit wide TIM counter and PRD period registers of the second stage of the timer will be used. This means the ISR will copy the TIM counter register to data memory.
- 3) In this application, the ISR consists of four instructions, thereby requiring a total of four locations in the vector table, thus reducing the external interrupt capability of the TMS320C5x by one.
- 4) The interrupt latency of the TMS320C5x depends on the current contents of the pipeline. The device always completes all instructions in the pipeline before executing the soft vector. It is up to the software engineer not to use multiple-cycle instructions or noninterruptible instructions (such as RPT & RPTZ) during the inner loop routine of the bar code scanner routine.
- 5) The inner loop of the bar code scanner routine is small enough to be run out of internal program space. This could be from internal ROM or from internal program RAM. This will minimize



the execution time of copying the Timer Counter register to data memory.

- 6) The ISR dedicates AR5 as a pointer to the memory location where the TIM counter register gets written. AR5 is incremented within the ISR so that the information is constantly stored in different memory locations. AR5 cannot be used in the main program.

ISR Implementation

An external interrupt is generated whenever the edge of a bar code is detected. The TMS320C5x will recognize the interrupt and vector to an ISR which copies the TIM Timer counter register out to data memory and returns to the main routine. The ISR consists of the following instructions:

```
MAR      *,AR5      ; Load ARP with 5
LAMM     TIM        ; Load lower half of ACC with
                  ; TIM counter
SACL     *+         ; Store ACC low indirectly to memory
RETE     ; Return to main program and
                  ; enable interrupts
```

TIM is the Timer counter register, which is a peripheral memory-mapped register. The LAMM is a single-word, two-cycle instruction. All the other instructions are single-word, single-cycle instructions.

The RETE is specified as a four-cycle instruction because the pipeline is flushed on the return from the ISR. It therefore takes four cycles to execute the next instruction in the main routine. Since as soon as the RETE is executed interrupts can occur, RETE can be considered a single-cycle instruction.

Table 1 illustrates what the pipeline looks like when two consecutive interrupts are recognized by the TMS320C5x. The first interrupt occurs before cycle 1, whereas the second interrupt occurs before cycle 13. The significant pipeline events are summarized after Table 1.

Table 1. Calculating the minimum time between interrupts

		←First Interrupt							
Cycle	0	1	2	3	4	5	6	7	8
Fetch	I1	I2	I3	I4	I5	I6	D	D	D
Decode	-	I1	I2	I3	I4	I5	INTR	D	D
Read	-	-	I1	I2	I3	I4	I5	INTR	D
Encode	-	-	-	I1	I2	I3	I4	I5	INTR

		← Second Interrupt →			← Second Interrupt occurs in this interval				
Cycle	9	10	11	12	13	14	(15)	16	17
Fetch	MAR	LAMM	SACL	D	RETE	D	D	D	I6
Decode	D	MAR	LAMM	SACL	D	RETE	D	D	-
Read	D	D	MAR	LAMM	D	SACL	RETE	D	-
Encode	D	D	D	MAR	LAMM	LAMM	SACL	RETE	-

Cycle	18	19	20	21	22	23	24	25	26
Fetch	D	D	D	MAR	LAMM	SACL	D	RETE	D
Decode	INTR	D	D	D	MAR	LAMM	SACL	D	RETE
Read	-	INTR	D	D	D	MAR	LAMM	D	SACL
Encode	-	-	INTR	D	D	D	MAR	LAMM	LAMM

Cycle	(27)	28	29	30	31	32	33	34	35
Fetch	D	D	I6						
Decode	D	D	-						
Read	RETE	D	-						
Encode	SACL	RETE	-						

Legend

I	Represents the specific instruction number, n
D	Stands for DUMMY cycle
MAR	Modify Auxiliary Register
LAMM	Load Accumulator low with contents of TIM register
SACL	Store Accumulator Low out to Data Memory
RETE	Return from interrupt and clear INTM bit (globally enable interrupts)

Explanation of Table 1

- 1) Cycle 0 - 1 - High-to-low transition of “1st” external interrupt occurs before the fetch of I2.
- 2) Cycle 3 - Interrupt must be held low for three clock cycles, whereupon it is recognized by the CPU.
- 3) Cycle 4 - Appropriate bit of Interrupt Flag Register (IFR) is set signifying an interrupt has occurred.



- 4) Cycle 5 - I6 is fetched, however, it will be re-fetched after the return from interrupt.
- 5) Cycle 6 - INTR jammed into the pipeline.
- 6) Cycle 9 - Start of first instruction in the ISR. INTM is set to a 1 (INTM=1) and an IACK is generated. INTM is a global interrupt bit and will globally disable any interrupts from occurring. IACK clears an internal TMS320C5x flip-flop and allows a bit in the IFR register to be set by the next external interrupt.
- 7) Cycle 10 - LAMM, a 1-word, 2-cycle instruction, is fetched.
- 8) Cycle 9 - 13 - High-to-low transition of "2nd" external interrupt (could actually occur sometime after cycle 9 and before cycle 13).
- 9) Cycle 15 - SACL instruction executes completing the write of the TIM Timer counter register to data memory [pointer register (AR5) is updated by 1].
- 10) Cycle 16 - RETE instruction executes causing a return to the main program and causing INTM=0 (global interrupt enabled). The pending (second) interrupt can be recognized starting at the next cycle.
- 11) Cycle 17 - I6 is fetched, however, it will be re-fetched after the return from interrupt.
- 12) Cycle 18 - INTR jammed into the pipeline.
- 13) Cycle 27 - SACL instruction executes completing the write of the TIM Timer counter register, corresponding to the second interrupt, to data memory.

In this analysis, the TMS320C5x cannot distinguish as to when the actual interrupt occurred between cycles 9 and 13. It will respond to the interrupts in the same way. Let's assume the second interrupt occurs right before cycle 10. It will take four cycles from when the second interrupt occurs until it is recognized by the CPU and the Interrupt Flag Register bit of the IFR is set. The processor will wait until the INTM = 0 before recognizing the new interrupt. This occurs at cycle 16. Although I6 is fetched in cycle 17, it is discarded when INTR is jammed into the pipeline at cycle 18.

The Timer counter register values are copied to data memory in cycles 15 and 27. Therefore the bar code width is calculated as follows:

Bar Code Width

$$\begin{aligned} &= (\text{Clock cycle 27} - \text{Clock cycle 15}) * (\text{CLKOUT1 period}) \\ &= (12 \text{ cycles}) * (25 \text{ ns per cycle}) \\ &= (12 * 25 \text{ ns}) \\ &= 300 \text{ ns} \end{aligned}$$

In the above calculation it was assumed the second interrupt occurred between cycles 9 and 13. If the second interrupt occurs at cycle 14, then the reading of the Timer value to data memory will be delayed by one additional cycle (if it occurs at cycle 15, then it will be delayed by two cycles and so forth).

Conclusion

The TMS320C5x is able to recognize interrupts every 12 clock cycles. There are three instructions, or four cycles consumed by the ISR. Since the TMS320C5x is a pipelined architecture, it is difficult to calculate the interrupt latency. For this analysis the best case interrupt latency is found to be eight cycles ($12 - 4$).